



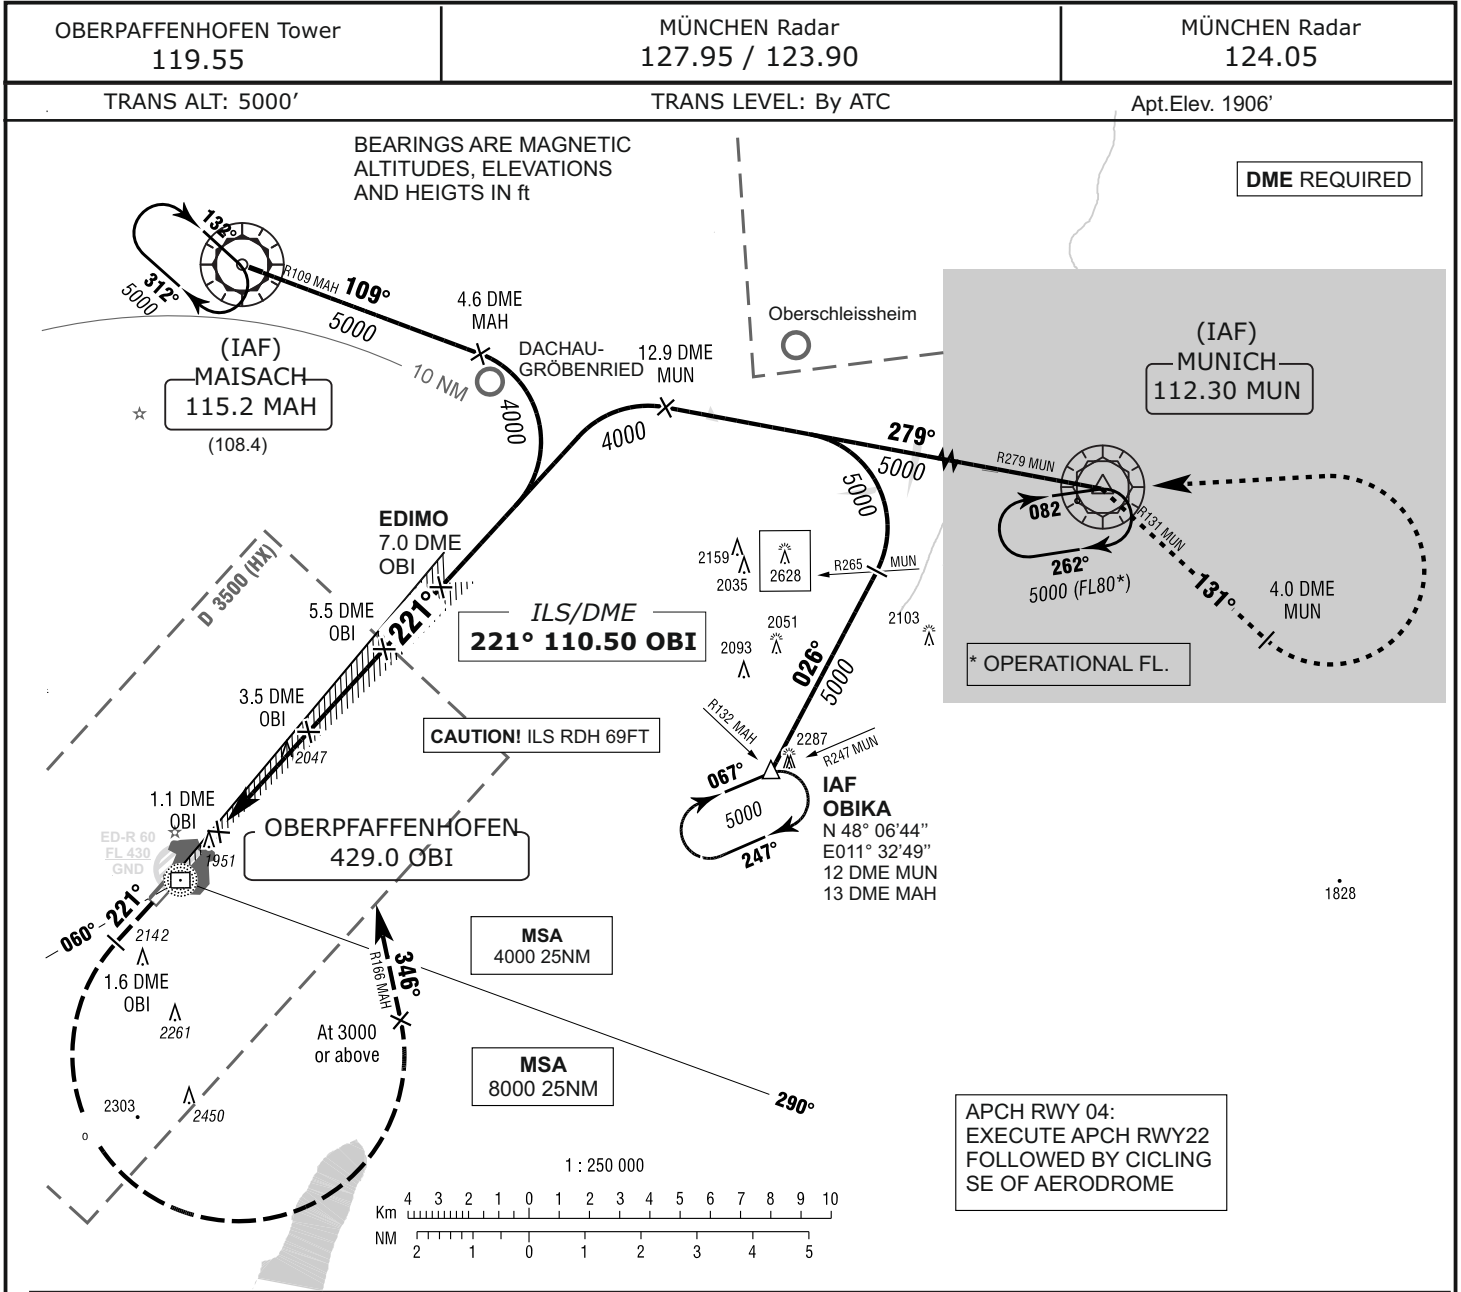

MISSED APPROACH PROCEDURE

On track 221° to 1.6 DME OBI
LT to intercept R166 inbound MAH at 3000
or above. Continue to MAH climbing to 5000

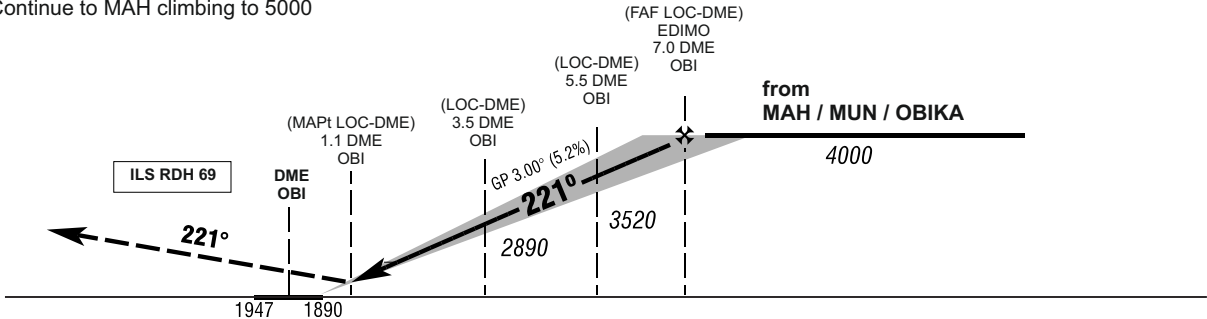

OCA (OCH)	A	B	C	D
ILS CAT I	2082 (192)	2092 (202)	2102 (212)	2112 (222)
LOC-DME	2290 (400)	2290 (400)	2290 (400)	2290 (400)
CIRCLING*	2490 (550)	2560 (610)	2850 (900)	2850 (900)

DME OBI	2	3	4	5	6			
DIST THR	1.4	2.4	3.4	4.4	5.4			
ALTITUDE	2410	2730	3050	3360	3680			
Timing not authorized for defining the MAPt.								
Ground Speed	kt	80	100	120	140	160	180	
3.5 DME OBI-THR (2.9 NM)	MIN:SEC	2:11	1:44	1:27	1:15	1:05	0:58	
Rate of decent (5.2%)	ft / MIN	420	530	630	740	840	950	

Do not use for real life navigation!

Revision: 2015-04-02 - Change: OCA(H) values, procedure, ED-R 60